

New Berry Bucket Pin Upgrade



Part Number: 160697

Oxbo now offers a new, improved bucket pin that is compatible with any 7440, 7420 or 9120 harvester. The new pin has the same diameter as the existing pins at either end, but is thicker in the middle to create a shoulder. This design delivers improved chain tracking and service life of the pin.

New



Original

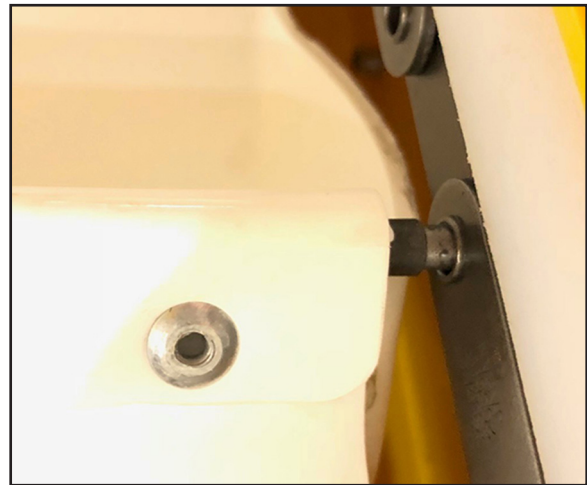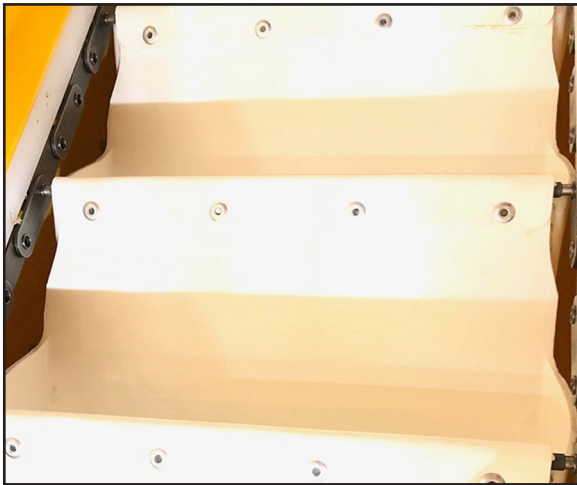

Note: the shoulder on the new pin is larger than the diameter of the hole in the chain and can not be inserted from the end. Therefore, the original pin is still valuable for quick, in-field repair during harvest.

Hardware		
Item	Quantities	Part Number
Buckets	166	150999
Bucket Pins	166	160697
Cotter Pins Kits (100 per kit)	4	62462
Washers	16	94349
Aluminum Washers	664	99132
Rivets	664	99135
Screws	8	99211
Nuts	8	902672
Bucket Chains	4	KB6212

*See assembly part number 150240 for more detailed information and potential additional hardware needed.

Contact your dealer or call 360-354-1500 ext. 3 for more information

www.oxbocorp.com